

Work Order ID 94882

December-20-12 2:52:20 PM

94882

Page 1

Item ID: D212-664-201TRN

Accept

N900040100

Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Crosstube Turning Detail

Start Date: 20/12/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 03/01/2013 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: ML5

Date: 12-12-20 Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D212-664-241	Rev D

100	MORI SEIKI CNC LATHE LARGE	0.00
-----	----------------------------	------

100

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA114

2-Turn first side as per Folio FA114

3-Blend transition lines only, **do not sand whole tube**:

FOLIO REV: AD

DWG REV: D

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

1 ϕ KC
13-01-05

Pho →

110	QC1- Inspect dimensions to dimension sheet	0.00
-----	--	------

110

QC

Memo

0.00

Quality Control

1 ϕ KC
13-01-05

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: dw Date: 2013/01/23QA Closed: cl Date: 11

Work Order: <u>94882</u>	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input checked="" type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS			
Part No. <u>D212-664-201TR</u>		Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/>	Crosstube <input checked="" type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/>	Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/>	Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/>
NCR No. <u>13-2242</u>					

Root Cause		Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data		13/1/15	160	1	- Both Cuffs are out of tol. Both range from 2.95-3.006 - tube has MEASUREMENTS over tol. throughout	DAS 12 2-89 13/1/15	Cuffs are acceptable, Saddle fits OK. S.D. measurements are OK	JG 12 2-89 13/1/15	JW 13-01-16	DAS 16 2-89 13/1/23
Equip/Tooling										
Operator										
Material	+									
Setup										
Other										
Process										
Supplier										
Training										
Unapproved										

FAULT CATEGORY

Landing Gear	General	
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete
<input type="checkbox"/> Crushed/Crimped.	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions
		<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge
		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other

Work Order ID 94882

December-20-12 2:52:20 PM

94882

Page 2

Item ID: D212-664-201TRN

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Turning Detail

Start Date: 20/12/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 03/01/2013 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run

Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

120

0.00

120

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Turn second side as per Folio FA114

2-Blend transition lines only, **do not sand whole tube**:

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

FOLIO REV: ADDWG REV: 0

3-Remove sand and plugs

4- scribe batch # and part # as per dwg

1 ϕ KC
13-01-05

130

QC1- Inspect dimensions to dimension sheet

0.00

130

QC

Memo

0.00

Quality Control

1 ϕ KC
13-01-05

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data <input type="checkbox"/>											
Equip/Tooling <input type="checkbox"/>											
Operator <input type="checkbox"/>											
Material <input type="checkbox"/>											
Setup <input type="checkbox"/>											
Other <input type="checkbox"/>											
Process <input type="checkbox"/>											
Supplier <input type="checkbox"/>											
Training <input type="checkbox"/>											
Unapproved <input type="checkbox"/>											

FAULT CATEGORY									
Landing Gear			General						
<input type="checkbox"/>	Bending	<input type="checkbox"/>	Bend	<input type="checkbox"/>	Grain	<input type="checkbox"/>	Ovalized	<input type="checkbox"/>	Pressure/Forced
<input type="checkbox"/>	Centre Not Concentric to O/S	<input type="checkbox"/>	BOM/Route	<input type="checkbox"/>	Hardware	<input type="checkbox"/>	Over/Under tolerance	<input type="checkbox"/>	Temperature/Cure
<input type="checkbox"/>	Cracks	<input type="checkbox"/>	Broken/Damaged	<input type="checkbox"/>	Inspection Incomplete	<input type="checkbox"/>	Part Incorrect	<input type="checkbox"/>	Weld
<input type="checkbox"/>	Crushed/Crimped	<input type="checkbox"/>	Burrs	<input type="checkbox"/>	Instructions Incomplete/Unclear	<input type="checkbox"/>	Part Lost/Missing	<input type="checkbox"/>	Wrong Stock Pulled
<input type="checkbox"/>	Cuffs	<input type="checkbox"/>	Contamination	<input type="checkbox"/>	Maintenance	<input type="checkbox"/>	Part Moved		
<input type="checkbox"/>	Heat Treat	<input type="checkbox"/>	Countersink	<input type="checkbox"/>	Mislabeled	<input type="checkbox"/>	Positioned Wrong	<input type="checkbox"/>	Other
<input type="checkbox"/>	Inspection Strip in Tube	<input type="checkbox"/>	Cut Too Short	<input type="checkbox"/>	Misread	<input type="checkbox"/>	Power Loss/Surge		
<input type="checkbox"/>	Ripples in Bend	<input type="checkbox"/>	Drill Holes	<input type="checkbox"/>	Offset				
<input type="checkbox"/>	Torque Waves in Extrusion	<input type="checkbox"/>	Drawing	<input type="checkbox"/>	Out of Calibration				
<input type="checkbox"/>	Turning Sequence	<input type="checkbox"/>	Finish	<input type="checkbox"/>	Out of Sequence				
<input type="checkbox"/>	Wave/Twist in Tube	<input type="checkbox"/>	Folio	<input type="checkbox"/>	Outside Dimensions				

Work Order ID 94882

December-20-12 2:52:20 PM

94882

Page 3

Item ID: D212-664-201TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Turning Detail

Stop ***NS2***

Start Date: 20/12/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 03/01/2013 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

140

QC8- Inspect parts - second check

0.00

140

QC

Memo

0.00

Quality Control

JW 13-01-16

145

0.00

145

Crosstubes

Memo

0.00

Crosstubes

GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.

JW 13-01-16

150

0.00

150

HandFXtube

Memo

0.00

Hand Finishing Crosstubes

1- PRESSURE WASH X-TUBE INSIDE AND OUT

2- ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE

JW 13-01-17

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data <input type="checkbox"/>									
Equip/Tooling <input type="checkbox"/>									
Operator <input type="checkbox"/>									
Material <input type="checkbox"/>									
Setup <input type="checkbox"/>									
Other <input type="checkbox"/>									
Process <input type="checkbox"/>									
Supplier <input type="checkbox"/>									
Training <input type="checkbox"/>									
Unapproved <input type="checkbox"/>									

FAULT CATEGORY

Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube	General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio	<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions <input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge <input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other
---	---	--

Work Order ID 94882

December-20-12 2:52:20 PM

94882

Page 4

Item ID: D212-664-201TRN

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Crosstube Turning Detail

Stop ***NS2***

Start Date: 20/12/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 03/01/2013 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

160

QC5- Inspect part completeness to step on W/O

0.00

160

QC

Memo

0.00

Quality Control

D4
1035

13-1-18

170

Packaging

0.00

170

Packaging

Memo

0.00

Packaging

Identify and stock in kanban rack
Location: LG

JW

13-1-18

180

QC21- Final Inspection - Work Order Release

0.00

180

QC

Memo

0.00

Quality Control

13/01/22
13-01-18

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube <input type="checkbox"/></td> <td>Crosstube <input type="checkbox"/></td> <td>Water Jet <input type="checkbox"/></td> <td>Engineering <input type="checkbox"/></td> </tr> <tr> <td>Machining <input type="checkbox"/></td> <td>Small Fab <input type="checkbox"/></td> <td>Prod. Eng. Coord. <input type="checkbox"/></td> <td>Quality <input type="checkbox"/></td> </tr> <tr> <td>Thermoforming <input type="checkbox"/></td> <td>Finishing <input type="checkbox"/></td> <td>Rec/Store/Packaging <input type="checkbox"/></td> <td>Other <input type="checkbox"/></td> </tr> <tr> <td>Large Fab <input type="checkbox"/></td> <td>Composite <input type="checkbox"/></td> <td>Supplier <input type="checkbox"/></td> <td></td> </tr> </table>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>	
Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>															
Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coord. <input type="checkbox"/>	Quality <input type="checkbox"/>															
Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>															
Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>																

Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									

FAULT CATEGORY

Landing Gear	General	Other	Other
<input type="checkbox"/> Bending	<input type="checkbox"/> Bend	<input type="checkbox"/> Grain	<input type="checkbox"/> Ovalized
<input type="checkbox"/> Centre Not Concentric to O/S	<input type="checkbox"/> BOM/Route	<input type="checkbox"/> Hardware	<input type="checkbox"/> Over/Under tolerance
<input type="checkbox"/> Cracks	<input type="checkbox"/> Broken/Damaged	<input type="checkbox"/> Inspection Incomplete	<input type="checkbox"/> Part Incorrect
<input type="checkbox"/> Crushed/Crimped	<input type="checkbox"/> Burrs	<input type="checkbox"/> Instructions Incomplete/Unclear	<input type="checkbox"/> Part Lost/Missing
<input type="checkbox"/> Cuffs	<input type="checkbox"/> Contamination	<input type="checkbox"/> Maintenance	<input type="checkbox"/> Part Moved
<input type="checkbox"/> Heat Treat	<input type="checkbox"/> Countersink	<input type="checkbox"/> Mislabeled	<input type="checkbox"/> Positioned Wrong
<input type="checkbox"/> Inspection Strip in Tube	<input type="checkbox"/> Cut Too Short	<input type="checkbox"/> Misread	<input type="checkbox"/> Power Loss/Surge
<input type="checkbox"/> Ripples in Bend	<input type="checkbox"/> Drill Holes	<input type="checkbox"/> Offset	<input type="checkbox"/> Pressure/Forced
<input type="checkbox"/> Torque Waves in Extrusion	<input type="checkbox"/> Drawing	<input type="checkbox"/> Out of Calibration	<input type="checkbox"/> Temperature/Cure
<input type="checkbox"/> Turning Sequence	<input type="checkbox"/> Finish	<input type="checkbox"/> Out of Sequence	<input type="checkbox"/> Weld
<input type="checkbox"/> Wave/Twist in Tube	<input type="checkbox"/> Folio	<input type="checkbox"/> Outside Dimensions	<input type="checkbox"/> Wrong Stock Pulled
			<input type="checkbox"/> Other

Picklist Print

December-20-12 2:52:24 PM

Page 1

Work Order ID: 94882

94882

Parent Item: D212-664-201TRN

D212-664-201TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 20/12/2012

Required Date: 03/01/2013

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A 08-03-06 new issue DD verified by:ec
IPP Rev B 08.04.02 Removed polish EC verified DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6006-129		Manufactured	No			120	Each	10.0000	1	1			
D6006-129													
Crosstube Material													

**

Location

Loc Qty

Loc Code

LG015

10

26550

1

69838

9

KC
13-05-01

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework <input type="checkbox"/> Scrap <input type="checkbox"/> Use-as-is <input type="checkbox"/> Work Order Update <input type="checkbox"/>		AGAINST DEPARTMENT/PROCESS <div style="display: flex; justify-content: space-between;"> <div> Skid-tube <input type="checkbox"/> Machining <input type="checkbox"/> Thermoforming <input type="checkbox"/> Large Fab <input type="checkbox"/> </div> <div> Crosstube <input type="checkbox"/> Small Fab <input type="checkbox"/> Finishing <input type="checkbox"/> Composite <input type="checkbox"/> </div> <div> Water Jet <input type="checkbox"/> Prod. Eng. Coord. <input type="checkbox"/> Rec/Store/Packaging <input type="checkbox"/> Supplier <input type="checkbox"/> </div> <div> Engineering <input type="checkbox"/> Quality <input type="checkbox"/> Other <input type="checkbox"/> </div> </div>						
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector			
Doc/Data <input type="checkbox"/>												
Equip/Tooling <input type="checkbox"/>												
Operator <input type="checkbox"/>												
Material <input type="checkbox"/>												
Setup <input type="checkbox"/>												
Other <input type="checkbox"/>												
Process <input type="checkbox"/>												
Supplier <input type="checkbox"/>												
Training <input type="checkbox"/>												
Unapproved <input type="checkbox"/>												
FAULT CATEGORY												
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube			General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio			<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructor's Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions			<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled <input type="checkbox"/> Other	


DART AEROSPACE LTD	Work Order:	94882
Description: Crosstube Assembly (205/212 High Aft)	Part Number:	D212-664-241
Inspection Dwg: D212-664-241 Rev: D		Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

Inspection Sheet	Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	0.200	+/-0.010	210	✓		VERN	CNC-08
	R0.063	+/-0.010	.063	✓		RL	—
	2.990	+0.005/-0.000	2.992 min 2.997 max	✓		VERN	CNC-08
	5.237	+/-0.030	5.221	✓			
	2.600	+0.005/-0.000	2.605	✓			
	2.686	+0.005/-0.000	2.689	✓			
	2.770	+0.005/-0.000	2.775	✓			
	2.854	+0.005/-0.000	2.858	✓			
	2.938	+0.005/-0.000	2.939	✓			
	3.021	+0.005/-0.000	3.025	✓			
	3.133	+0.005/-0.000	3.137	✓			
	3.179	+0.005/-0.000	3.184	✓			
SIDE B	0.200	+/-0.010	210	✓		VERN	CNC-08
	R0.063	+/-0.010	.063	✓		RL	—
	2.990	+0.005/-0.000	2.990	✓		VERN	CNC-08
	5.237	+/-0.030	5.255	✓			
	2.600	+0.005/-0.000	2.603	✓			
	2.686	+0.005/-0.000	2.689	✓			
	2.770	+0.005/-0.000	2.773	✓			
	2.854	+0.005/-0.000	2.855	✓			
	2.938	+0.005/-0.000	2.938	✓			
	3.021	+0.005/-0.000	3.026	✓			
	3.133	+0.005/-0.000	3.136	✓			
	3.179	+0.005/-0.000	3.184	✓			
	124.362	+/-0.020	124.362	✓		TAPE	LG-15

DART AEROSPACE LTD	Work Order:	94882
Description: Crosstube Assembly (205/212 High Aft)	Part Number:	D212-664-241
Inspection Dwg: D212-664-241 Rev: D		Page 2 of 2

WALL THICKNESS MEASUREMENT

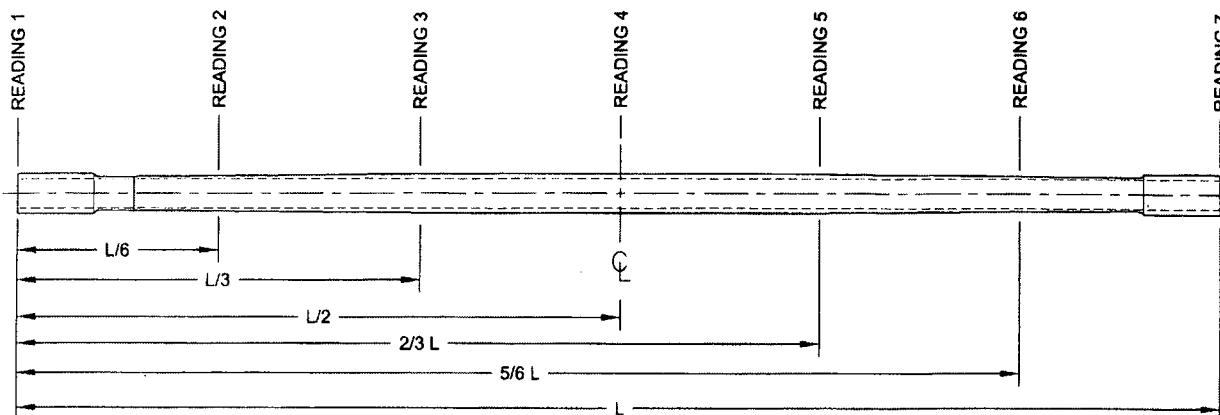

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.406	.393	.378	.394	.028	0.062"
READING 2 L= 20.727	.327	.324	.291	.297	.036	
READING 3 L= 41.454	.483	.488	.476	.475	.013	
READING 4 L= 62.181	.523	.518	.516	.521	.007	
READING 5 L= 82.908	.483	.472	.478	.491	.019	
READING 6 L= 103.635	.312	.296	.308	.324	.028	
READING 7 L= 124.362	.406	.385	.374	.394	.032	

Calibration Result

Actual Block Thickness: 250 - 750

SITESCAN 250 Measured Thickness: 250 - 750

Measured by: <u>KC</u>	Audited by: <u>JW</u>	Preliminary Approval:
Date: <u>13-1-06</u>	Date: <u>13-07-16</u>	Date:

Rev	Date	Change	Revised by	Approved
A	05.04.27	New Issue (P/O D412-664-201)	KJ/JLM	
B	06.03.09	Tolerance for 5.237 was +/-0.001	KJ/JLM	
C	07.05.08	Dwg Rev. updated	KJ/JLM	
D	10.08.03	Dimension 124.362 was 124.36	KJ	
E	12.06.04	Wall thickness form added	KJ	

Item	Qty -241	Qty -241B	Part Number	Description
1	X		D212-664-241	CROSSTUBE ASSEMBLY (205/212 HIGH AFT)
2		X	D212-664-241B	CROSSTUBE ASSEMBLY (214 HIGH AFT)
3	1	1	D6006-129	CROSSTUBE
4	2	2	D2940-1	SUPPORT
5	4	4	D3595-063-530	RUBBER CUSHION
6	4	4	MS21920-28	CLAMP (OR MS21920-30)
7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6006-129
FINISHED LENGTH = 124.362±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: D212-664-241 = 44.2 lbs (PER IIN-D212-664)
D212-664-241B = 44.2 lbs (PER IIN-D212-664)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 5 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2940-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2940-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-28 CLAMPS (OR -30) WITH D3595-063-530 RUBBER CUSHIONS TO SECURE THE D2940-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

SHAW COPY
REPAIR TO
ENGINEERING
UNCONTROLLED COPY
SUBMITTAL DOCUMENT
APPROVAL
94882 MJS
12-12-20

600 #11-614
11.08.28
UNDER REVIEW
01/06/13

DEO ATTACHED

RELEASED
2009-10-29
WY

D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS: ADD -241B (ZN D4-2, B4-2); REMOVED REF & ADD TOLERANCES (ZN D8-3 & C4-3, C6-3 & A8-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	09.09.30
C	REMOVE -1009 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	PH	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN	PH		
DRAWN	RF		
CHECKED	Q		
MFG. APPR.	LS		
APPROVED	W		
DE APPR.	H		
DATE	09.09.30		

DART AEROSPACE LTD
HAWKESBURY, ONTARIO, CANADA

DRAWING NO. REV. D
D212-664-241 SHEET 1 OF 4
TITLE SCALE
CROSSTUBE ASSY (205/212 HI AFT) NTS

COPYRIGHT © 2000 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD.

94882

12 13 15
D2940-1 SUPPORT
MS21920-28 CLAMP, 2X
D3595-063-530 RUBBER CUSHION, 2X
2 PL



14.00 (-241)
OR 13.75 (-241B) D

D212-664-601
BENT TUBE

CL
SYM

D212-664-241/-241B
ASSEMBLY DETAIL D

ECO#11-614
11.07.28
UNDER REVIEW
11.06.13

DEO ATTACHED

RELEASED
2009-10-28

12
APPLY MAGNOBOND
BETWEEN D2940-1 AND
CROSSTUBE

D2940-1 SUPPORT, REF


13 15
MS21920-28
CLAMP, REF

D3595-063-530 RUBBER CUSHION
UNDER CLAMP, REF

SECTION A-A D6-2
SCALE 4X

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	Q	DRAWING NO.	REV. D
MFG. APPR.	18	D212-664-241	SHEET 2 OF 4
APPROVED	160	TITLE	SCALE
DE APPR.	14	CROSSTUBE ASSY (205/212 HI AFT)	NTS
DATE	09.09.30	COPYRIGHT © 2009 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

94882

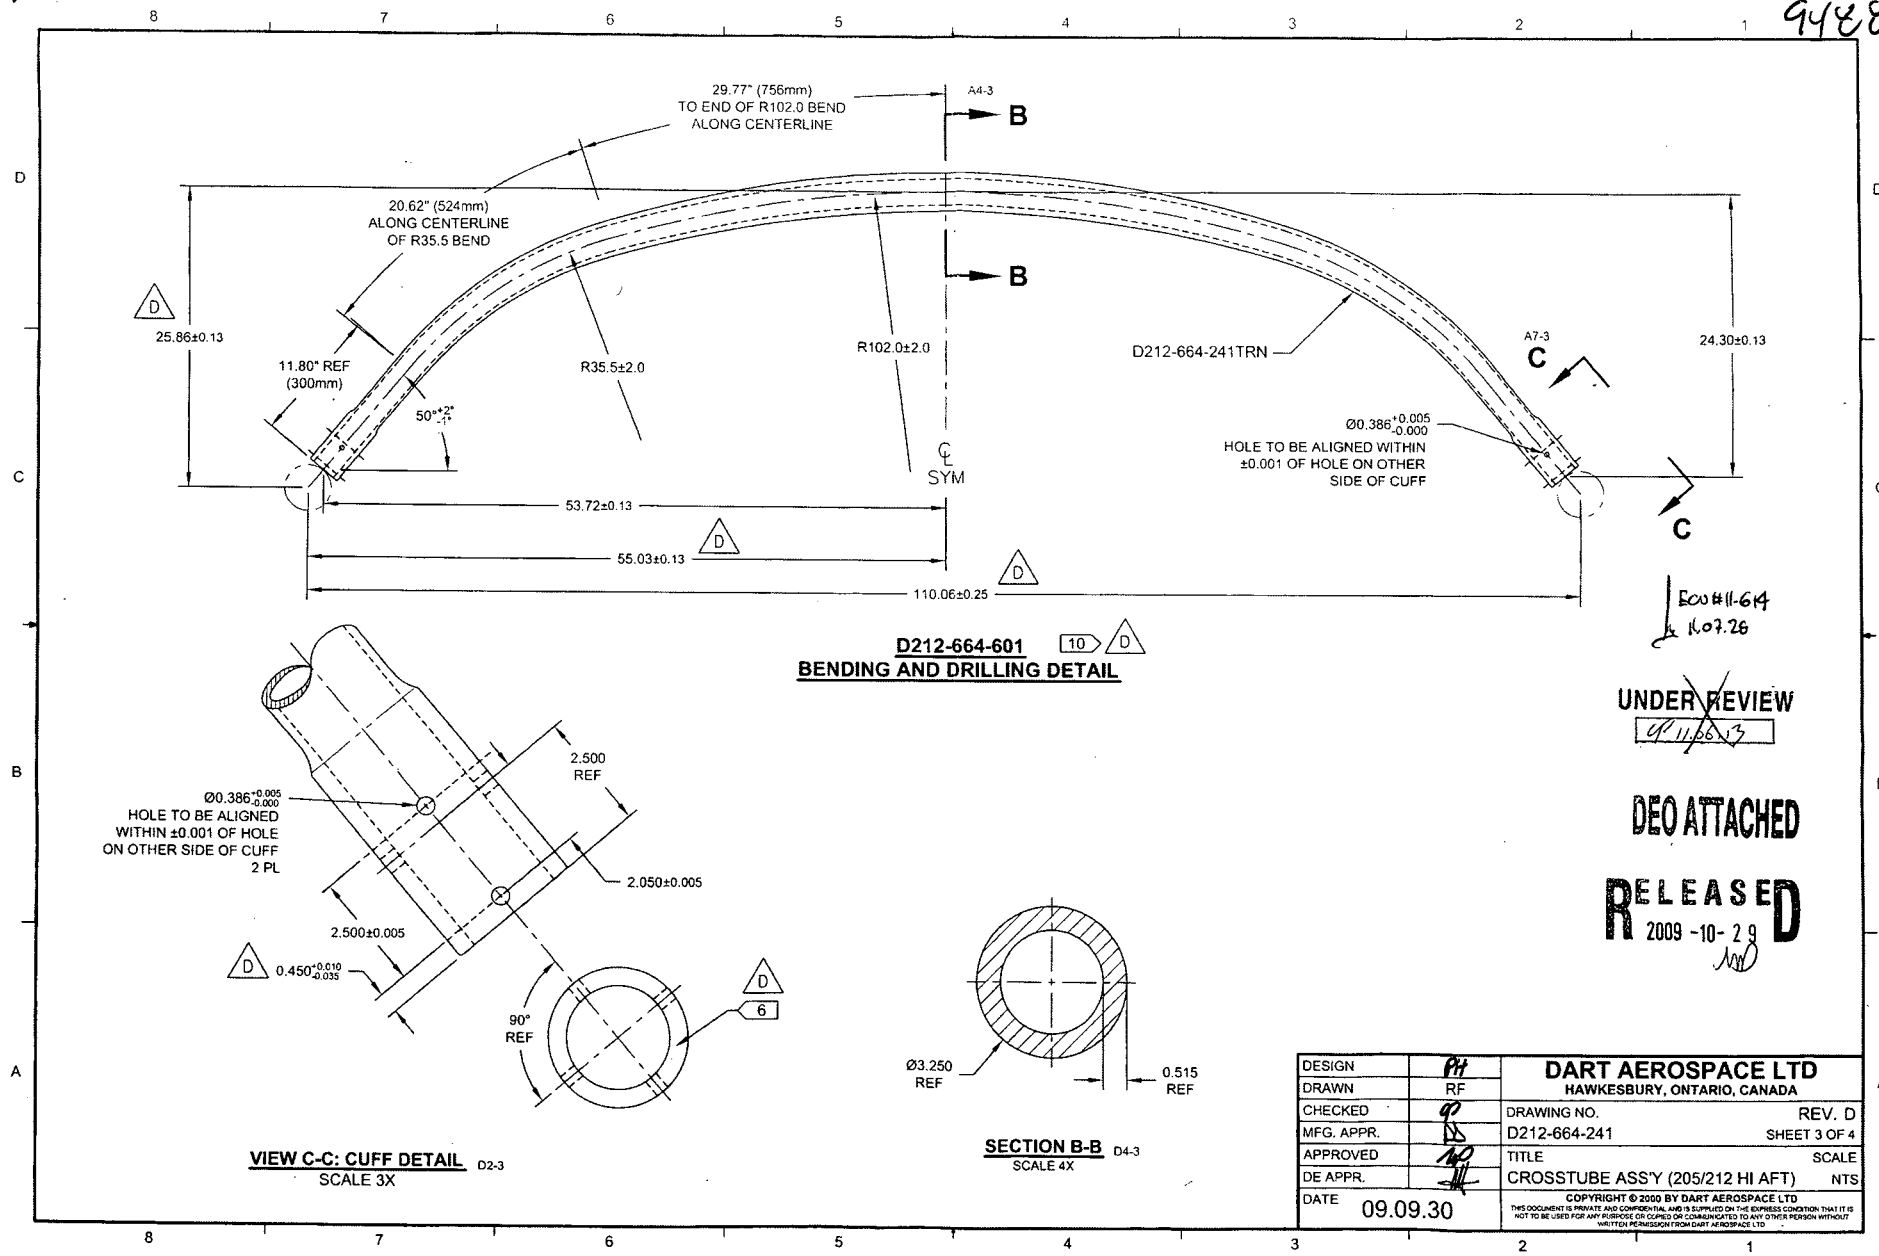

ECU#11-64
1.07.26

~~UNDER REVIEW~~
4/11/06/13

DEO ATTACHED

RELEASED
2009-10-29

COPYRIGHT © 2000 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE LTD.

94882

DRAWING NO. D212-664-241	TITLE CROSSTUBE ASSY (205/212 HI AFT)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-241-D-1	SHEET NO. SHEET 1 OF 2	SCALE NTS
DRAWN	CHECKED	MFG. APPR.	APPROVED	DE APPR.			
DATE 11.04.07	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12	DATE 11.04.12			

PURPOSE:

ADD AN INSPECTION WINDOW TO UNDERSIDE OF CROSSTUBE.

CHANGE:

NOTES 2 OF SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (HATCHED AREA) AND
PAINT OUTSIDE PER DART QSI 005 4.2
REMOVE MASKING AND APPLY CLEAR COAT

WAS:

- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2

RELEASED
2011-04-18

UNDER REVIEW

11.16.13

RCN#1-614


11.07.28

94482

DRAWING NO. D212-664-241	TITLE CROSSTUBE ASSY (205/212 HI AFT)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D212-664-241-D-1	SHEET NO. SHEET 2 OF 2	SCALE NTS
DRAWN	CHECKED <i>GP</i>	MFG. APPR. <i>E</i>	APPROVED <i>MD</i>		DE APPR. <i>MD</i>		
DATE 11.04.07	DATE 11.04.11	DATE 11.04.12	DATE 11/04/12		DATE 11.04.12		


IS:

WAS:

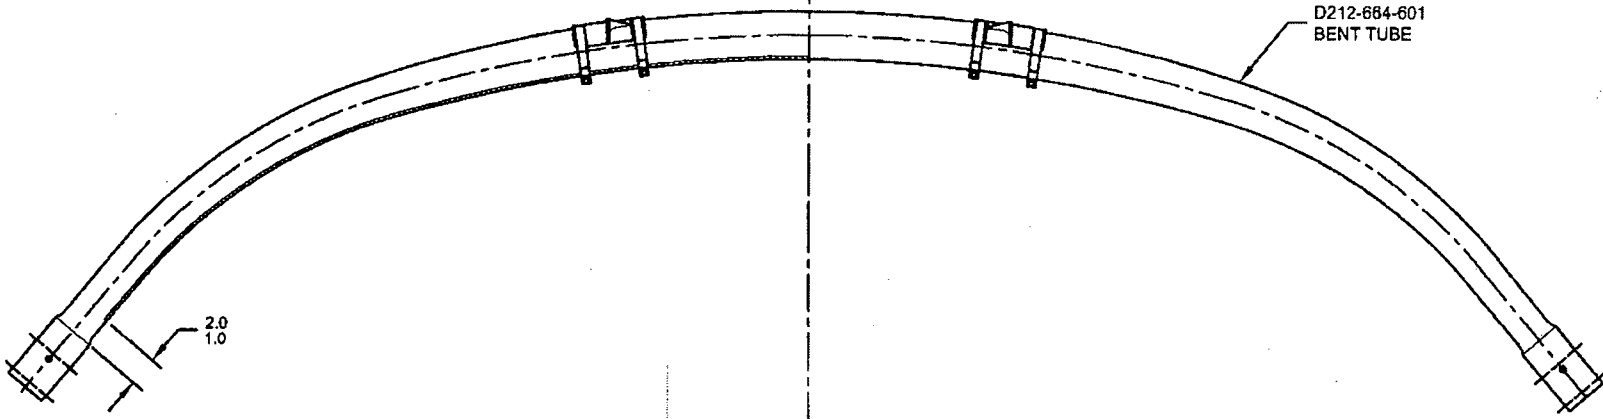

**D212-664-241/-241B
ASSEMBLY DETAIL**

MASK AREA PRIOR TO PAINTING,
REMOVE MASKING AFTER PAINT
AND APPLY CLEAR COAT

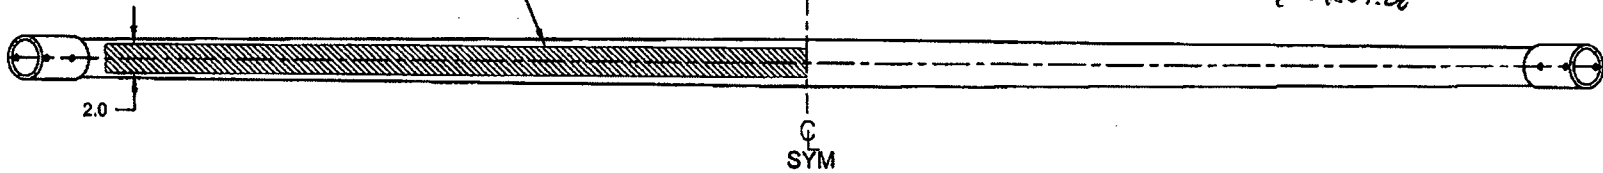

RELEASED
2011-04-18

UNDER REVIEW

GP 11.06.13
00211.041
11.07.28

94882

DRAWING NO. D212-664-241	TITLE CROSSTUBE ASS'Y (205/212 HI AFT)	REV. D	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D212-664-241-D-2	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>q</i>	CHECKED <i>ASS</i>	MFG. APPR. <i>DS</i>	APPROVED <i>MP</i>	DE APPR. <i>#</i>		
DATE 11.07.15	DATE 11.07.20	DATE 11.07.21	DATE 11.07.21	DATE 11.07.21		

PURPOSE:

REPLACE MAGNOBOND WITH PROSEAL.

CHANGE:

IS:

Item	Qty -241	Qty -241B	Part Number	Description
7	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

7	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

- 12) TO INSTALL D2940-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. **PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.**

WAS:

- 12) INSTALL D2940-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2940-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

RELEASED
2011-07-28
W

